





Appendix

I. TABLE OF SYMBOLS AND SIGNS

Symbols

The following symbols are used in this text (see Table, Appendix II for units not listed below).

A	= Area
a	= Linear acceleration
AC	= Alternating current
B, b	= Base of triangle used to measure slope of curve
C	= Capacitance (microfarads)
C	= Damping constant (lb-sec/ft)
C_c	= Critical damping constant (lb-sec/ft)
cg	= Center of gravity
cp	= Center of percussion
D	= Linear displacement
DC	= Direct current
E	= Voltage (volts)
F	= Force
g	= Acceleration due to gravity
H, h	= Height of triangle used to measure slope of curve
I	= Moment of inertia (slug-ft ²)
I	= Electrical current (amperes)
J	= Jerk (rate-of-change of acceleration—ft/sec ² /sec)
K	= Spring constant (pounds/ft)
K	= Coefficient of restitution (dimensionless)
L	= Length (ft)
L	= Inductance (henries)
m	= Mass (slugs)
N	= Gear ratio
Q	= Energy lost during impact (ft-lbs)
R, r	= Radius (ft)

R	= Electrical resistance (ohms)
t	= Time
Δt	= Elapsed time
v	= Linear velocity
v'	= Linear velocity following a collision or impact between two or more bodies (ft/sec)
W	= Weight (lbs)
X, Y, Z	= Coordinate axes
α	= Angular acceleration
ρ	= Density (slugs/ft ³)
β	= Angle (radians)
θ	= Angle (radians)
θ	= Angular displacement (radians)
τ	= Torque (ft-lbs)
ω	= Angular velocity (radians/sec)
ω'	= Angular velocity following a collision or impact between two or more bodies (radians/sec)
∞	= Infinity
	= Grounded pivot or bearing
	= Moving (translating) pin or bearing
	= Signifies motion in the direction indicated
	= Differential gear

Sign Conventions

Linear vector quantities (linear force, acceleration, velocity, displacement, etc.), are considered positive if upward, or to the right, in the XY plane. They are considered negative if downward, or to the left.

Rotational vector quantities (angular torque, acceleration, velocity, displacement, etc.) are considered positive if operating in a clockwise direction (looking toward the body along the axis of rotation or torque). They are considered negative if counterclockwise.

II. TABLE OF COMPATIBLE UNITS*
(Stick to any one column and you will stay out of trouble.)

Quantity	English		CGS	SI
Force	lb	ounce	dyne	newton
Acceleration	ft/sec ²	in./sec ²	cm/sec ²	m/sec ²
Velocity	ft/sec	in./sec	cm/sec	m/sec
Displacement	foot	inch	cm	meter
Mass	slug	oz sec ² /in.	gram	kilogram
Torque	ft-lb	in.-oz	cm-dyne	newton-meter
Angular Acceleration	rad/sec ²	rad/sec ²	rad/sec ²	rad/sec ²
Angular Velocity	rad/sec	rad/sec	rad/sec	rad/sec
Angular Displacement	radian	radian	radian	radian
Moment of Inertia	slugs-ft ²	inch-ounce-sec ²	g-cm ²	kg-m ²
Mass Density	slugs/ft ³	oz/in. ³	g/cm ³	kg/m ³
Volume	ft ³	in. ³	cm ³	m ³
Acceleration due to Gravity	32 ft/sec ²	384 in./sec ²	980 cm/s. ²	9.8 m/sec ²
Work	ft-lb	in.-oz	dyne-cm (erg)	joule
Potential Energy	ft-lb	in.-oz	dyne-cm (erg)	joule
Kinetic Energy	ft-lb	in.-oz	dyne-cm (erg)	joule
Impulse	lb-sec	oz-sec	dyne-sec	newton-sec
Momentum	slug ft/sec	oz in./sec	g cm/sec	kg m/sec
Time	second	second	second	second
Voltage	volt	volt	volt	volt
Current	ampere	ampere	ampere	ampere
Spring Constant	lbs/ft	ozs/in.	dynes/cm	newtons/meter

* If engineers were as rigorous as physicists they would be more familiar with the "correct" units of force in the SI and C-G-S systems of units: these correct units being the newton and dyne respectively. Unfortunately, we use spring scales and balance weights that are calibrated in grams and kilograms (units of mass) on the one hand, or calibrated in pounds and ounces (units of force) on the other. I strongly recommend that the reader convert data from "gram of force" or "kilogram of force" units to dynes and newtons whenever he encounters them. You can use the following formulae for converting:

$$\frac{\text{Grams of force}}{980} = \text{dynes}$$

$$\frac{\text{Kilograms of force}}{9.8} = \text{newtons}$$

III. GRAPHICAL INTEGRATION

There are several ways to integrate a curve graphically. Integration, of course, merely consists of "finding the area under" the curve. One way to do it is to draw the original curve on a piece of graph paper and then count the squares under the curve to determine area. The "value" of each square is determined by the scale factors used to plot the original curve, as explained in Chapter 1. (See Fig. A-1.)

Another method is to use algebraic equations to calculate areas under larger portions of the curve. This, of course, is only possible if these areas can be broken down into simple shapes such as rectangles, triangles, squares, etc. (See Fig. A-2.)

A third method is to use the instrument shown in Fig. A-3, which is called a *planimeter*. A stylus on one arm of the instrument is moved along the curve and along the axis which bounds the area to be measured. A small counting device on the planimeter then gives the total enclosed area. Again, the units of area must be related to the scale factors of the original curve.

IV. GRAPHICAL DIFFERENTIATION

There are several ways to find the differential of a curve at a given point, graphically. The first step in each case is to draw a line which is tangent to the curve at the point where the slope of the curve is to


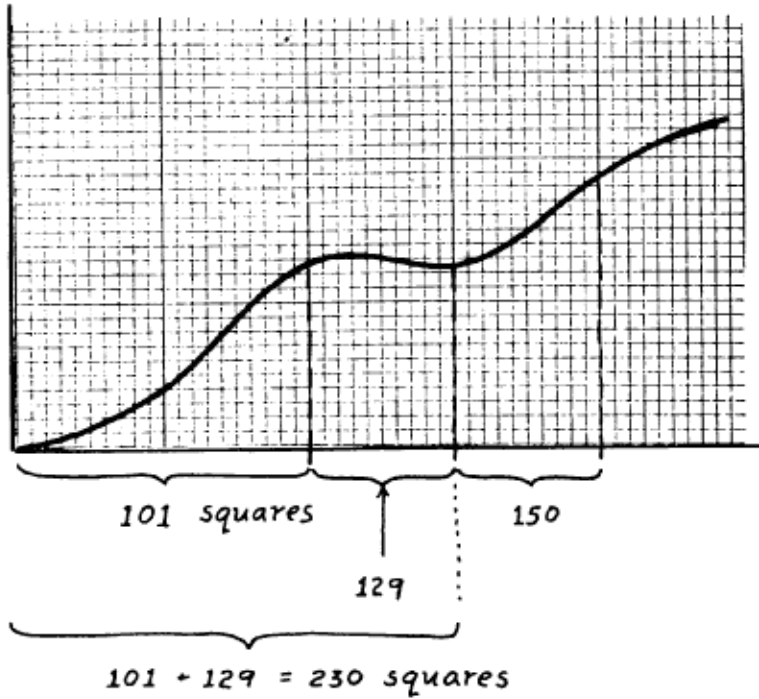


Fig. A-1. Counting the squares under a curve to integrate it graphically.

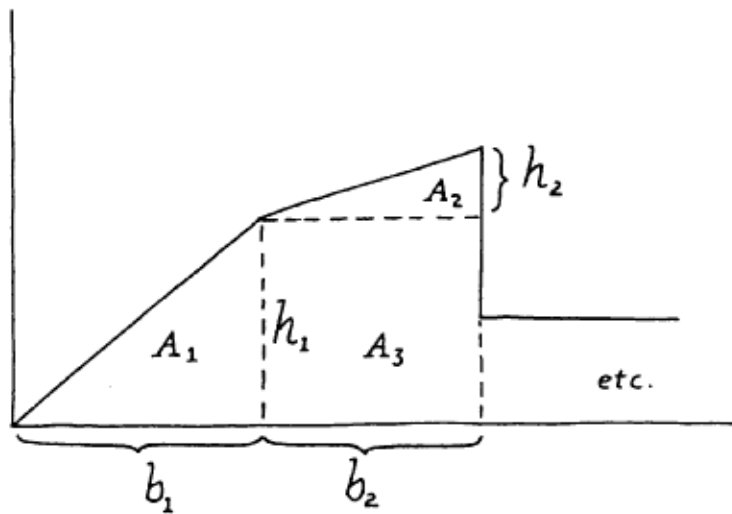

$$A_1 = \frac{1}{2} b_1 h_1$$

$$A_2 = \frac{1}{2} b_2 h_2$$

$$A_3 = b_2 h_1$$

Fig. A-2. Algebraic formulas can be used to plot the area under a curve.

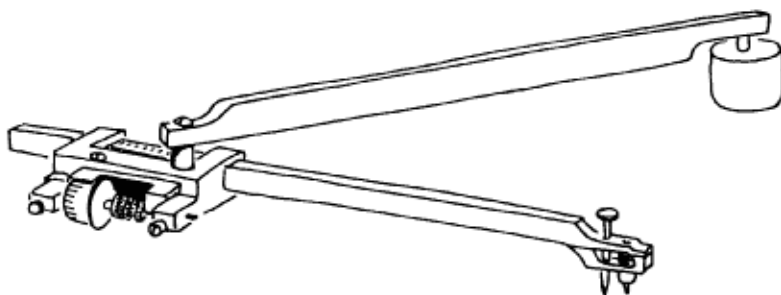


Fig. A-3. The planimeter, an instrument used to compute areas, can be used for graphical integration.

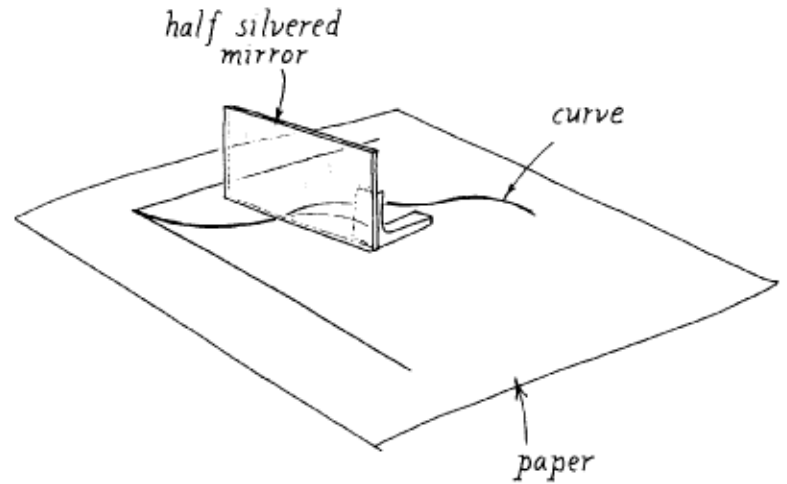


Fig. A-4. A half-silvered mirror, held perpendicular to the plane of the paper, will help you draw a line normal (perpendicular) to the curve. Draw a line along the bottom of the mirror after turning it so that the two images seen in (and through) the mirror coincide.

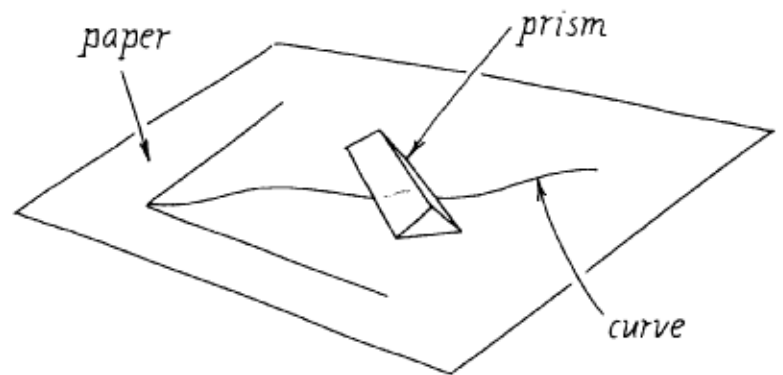


Fig. A-5. A prism can also be used to construct normal lines. The slope or tangent line, of course, is drawn at right angles to the normal line.

$$\text{tangent } \theta = \frac{1.60}{1.70}$$

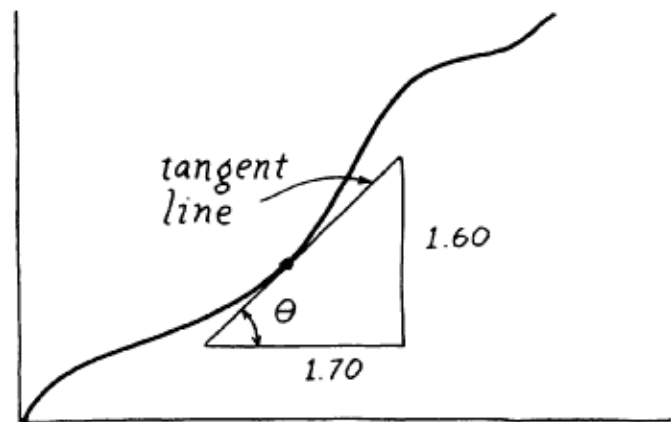


Fig. A-6. Slopes can be calculated algebraically. ("Slope" equals the tangent of the angle θ .)

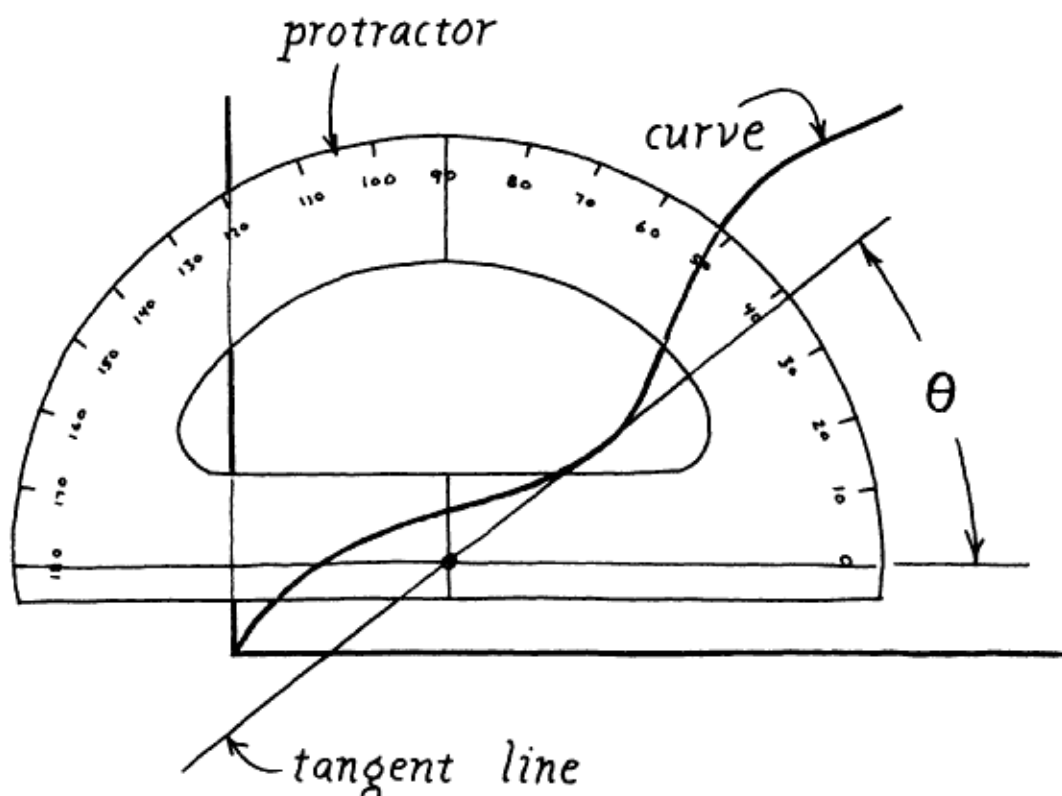


Fig. A-7. A protractor can be used to measure angle θ , whose tangent is then found in a trigonometric table.

be determined. There are three ways to construct such tangent lines which will be described here.

In many cases, you can merely draw the line in "by eye." If the curve is geometrically simple, and consists of a series of triangles, rectangles, or gentle curves, etc., then, of course, this is a very easy thing to do. If the curve is complex, the tangents you draw by eye may be in error to some extent, but this may not affect your final results too drastically if all you are after is an approximate "solution."

There are two instruments which can be used to improve the accuracy of the tangent line. One of them consists of a half-silvered mirror held perpendicular to the plane of the paper on which the original curve is drawn. (See Fig. A-4.) When the operator looks in this mirror he can see two lines. One of them is a reflection of the curve in front of the mirror, and dimly seen is the other, the remainder of the curve in back of (through) the mirror. The mirror is now rotated until these two images come together and appear to describe a single curve. A line is then drawn along the bottom of the mirror. This line is normal (or perpendicular) to the curve at the point of intersection. A drafting machine or a pair of triangles can now be used to draw a tangent line at this point, the tangent line of course, being perpendicular to the normal line.

A prism can also be used to find a normal to a curve. The prism is placed over the curve and the draftsman looks down into the prism at the image of the line which appears within it. In most orientations, the curve will appear to have been broken by the prism, which is now rotated until the curve once more appears to be a continuous line. A line drawn along the edge of the prism is again normal to the curve in this region and it can be used to construct a tangent line. (See Fig. A-5.) The prism technique, I think, is a little less accurate than the mirror technique where there are rapid changes in the curvature of the line being differentiated, but both have their place.

Once the tangent line has been drawn, we can proceed to determine the slope of that line; the slope being the tangent of the angle formed by that line and the horizontal axis. There are several ways to determine this slope.

The slope can be determined trigonometrically as shown in Fig. A-6 where we measure the height and base of the triangle formed by the tangent line and then divide one by the other to determine the tangent of the angle. Height and base, of course, must be measured in the units or scale factors used to plot the original curves.

Another technique is to use a conventional pro-

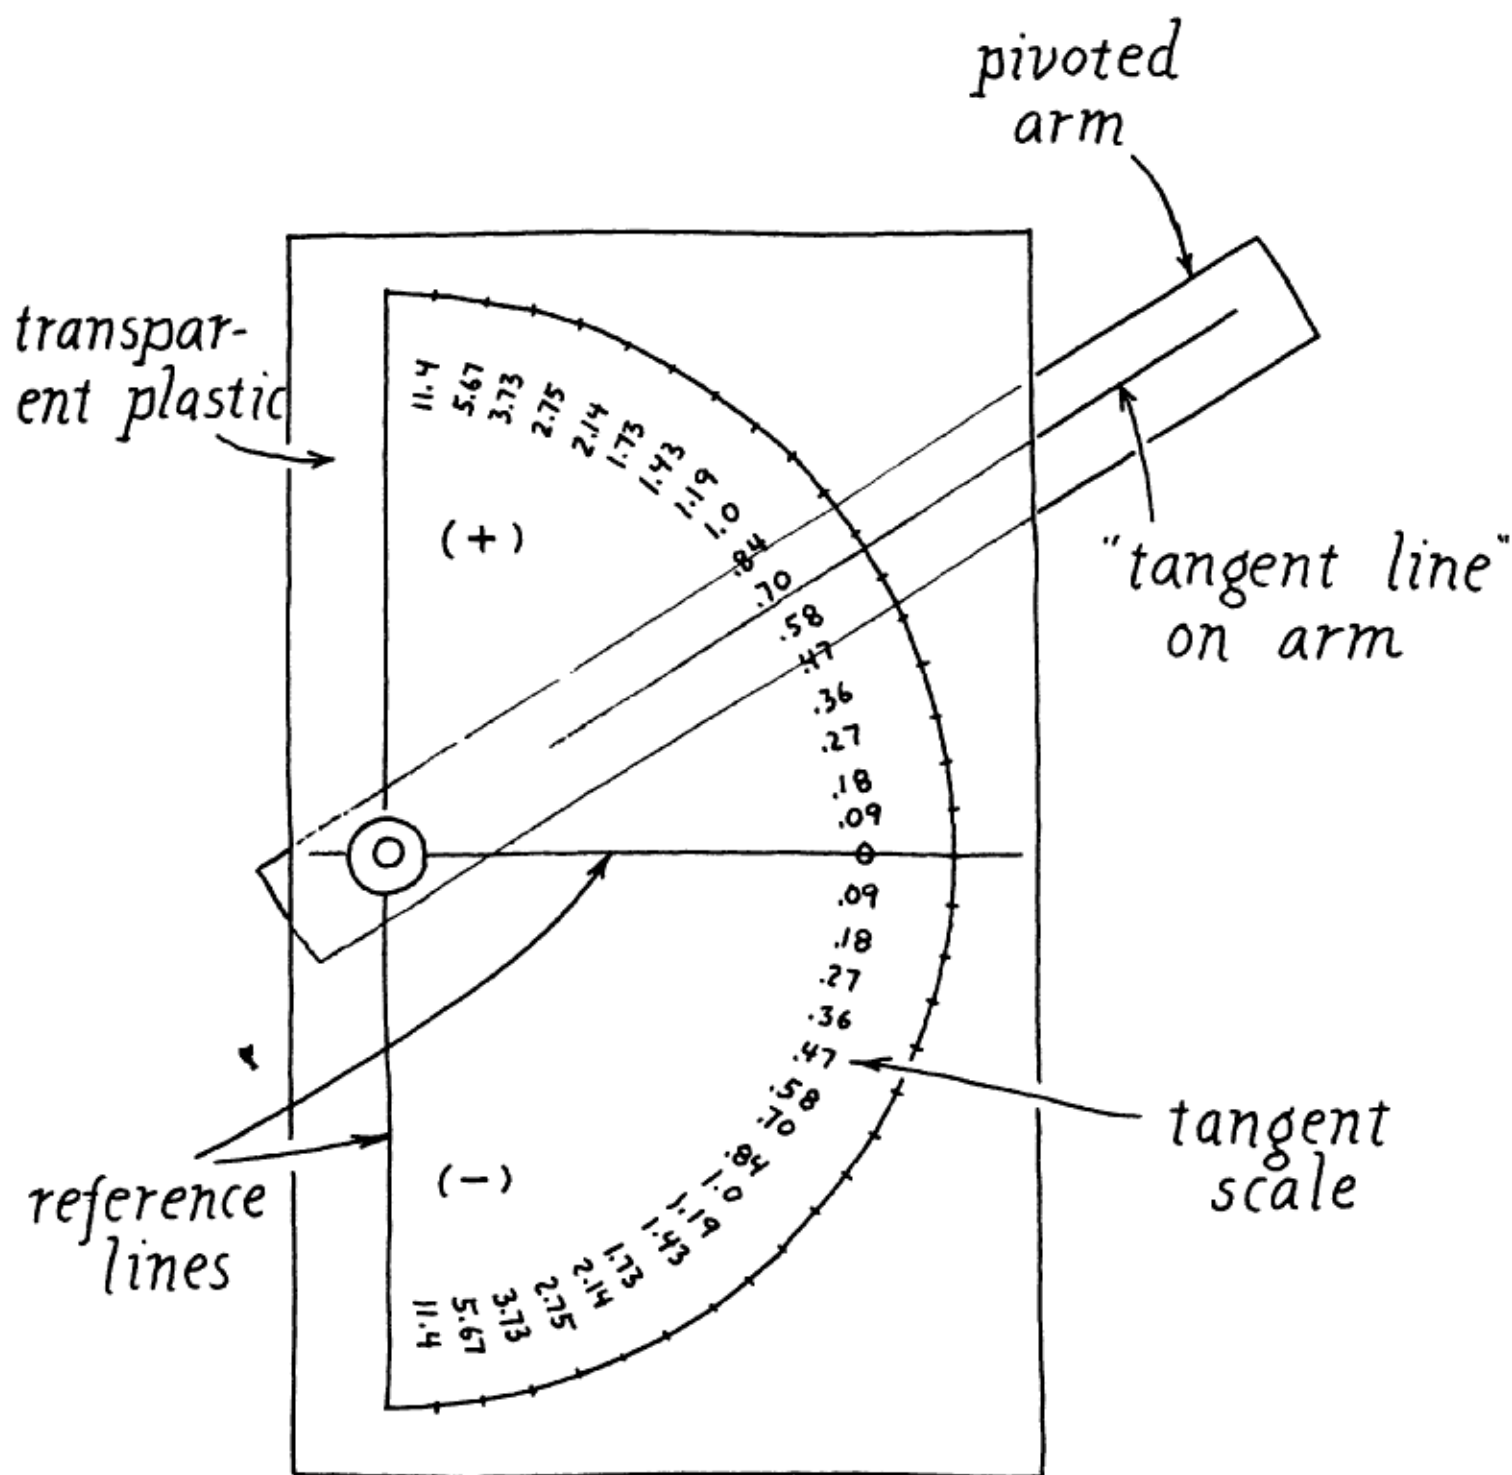


Fig. A-8. You can make a protractor of transparent plastic film (drafting film) and calibrate it in tangents rather than in angles. A line drawn on a pivoted arm is aligned with the curve, or with a previously drawn slope line. A great time saver.

tractor to measure the angle θ whose tangent is then found in a trigonometric table (slope = tangent θ). (See Fig. A-7.)

As a third method, you can make your own protractor from drafting film, calibrating it in tangents of the angles rather than in the angle itself. I have found this a very handy tool to make when there is a great deal of graphical differentiation to be done. It is even handier if the protractor is provided with a rotating arm as in Fig. A-8. A line drawn on this

arm is aligned with the slope line of the curve and the tangent of the slope angle is read directly on the protractor. The reference lines on the protractor, of course, must first be aligned with the axes of the graph.

V. MOMENTS OF INERTIA

The moment of inertia of a body is, of course, a measure of its resistance to angular acceleration.

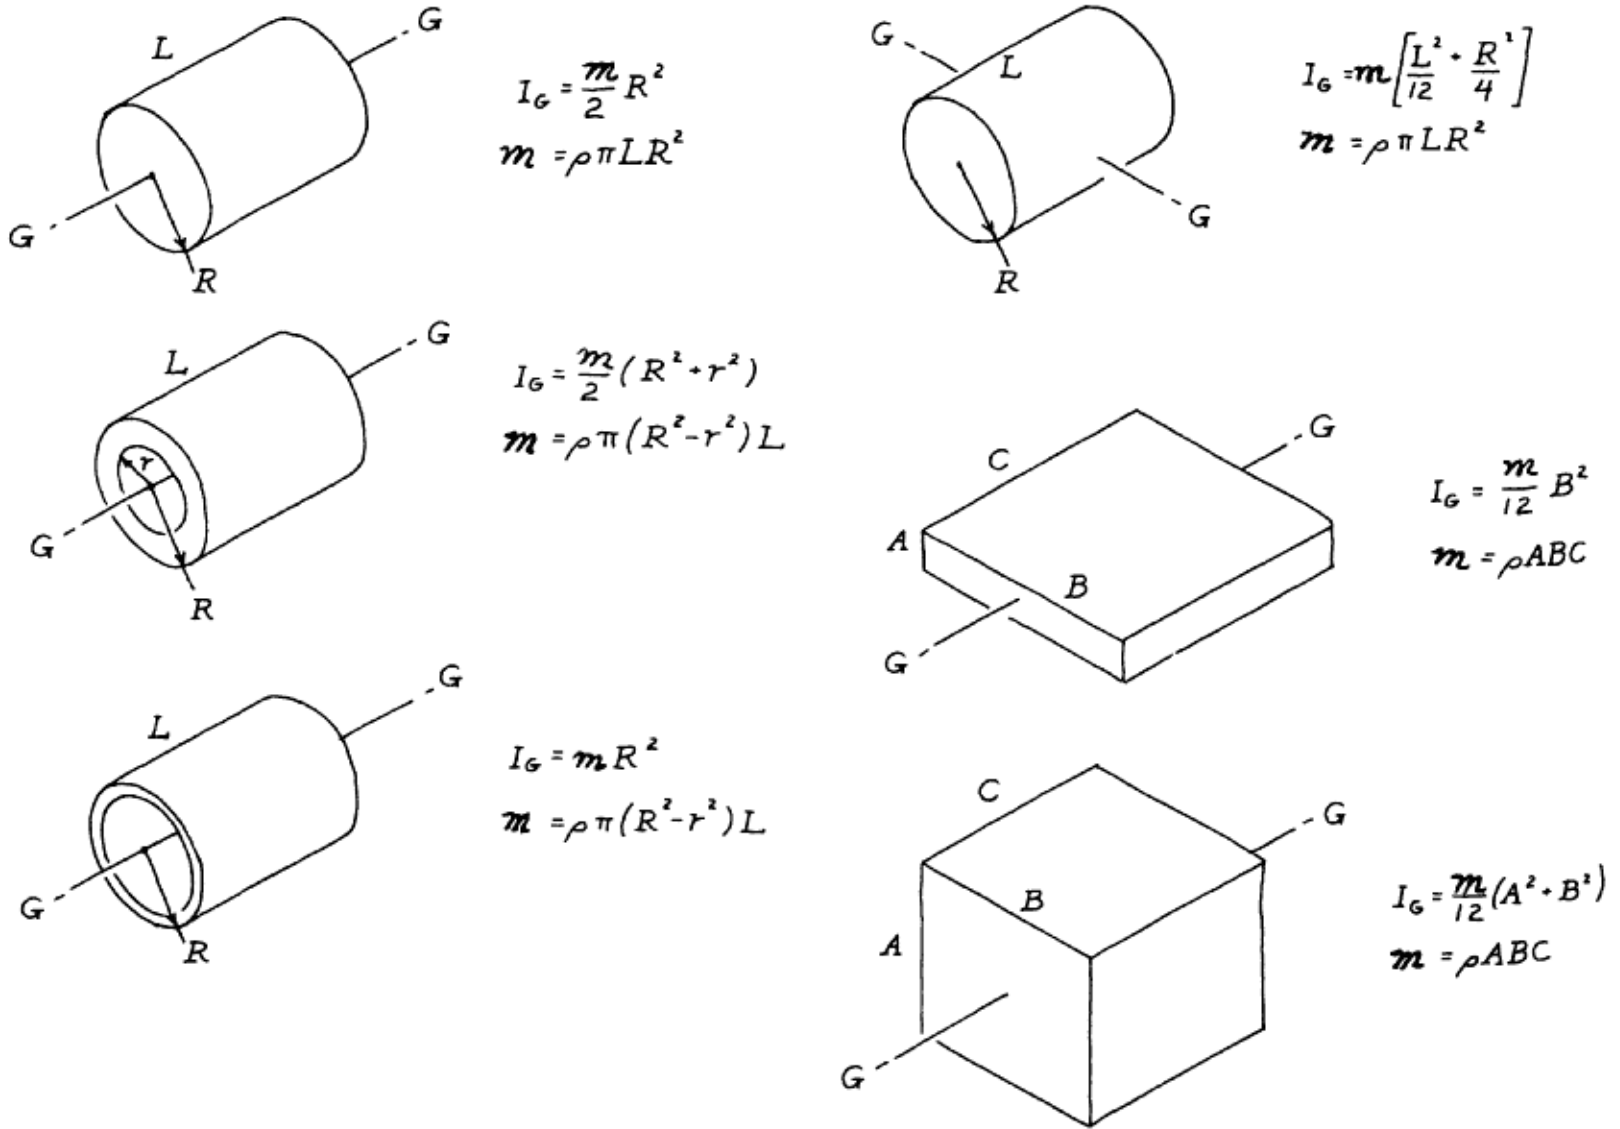


Fig. A-9. Moments of inertia for a few standard shapes. In each case the equation is for the moment about axis G-G.

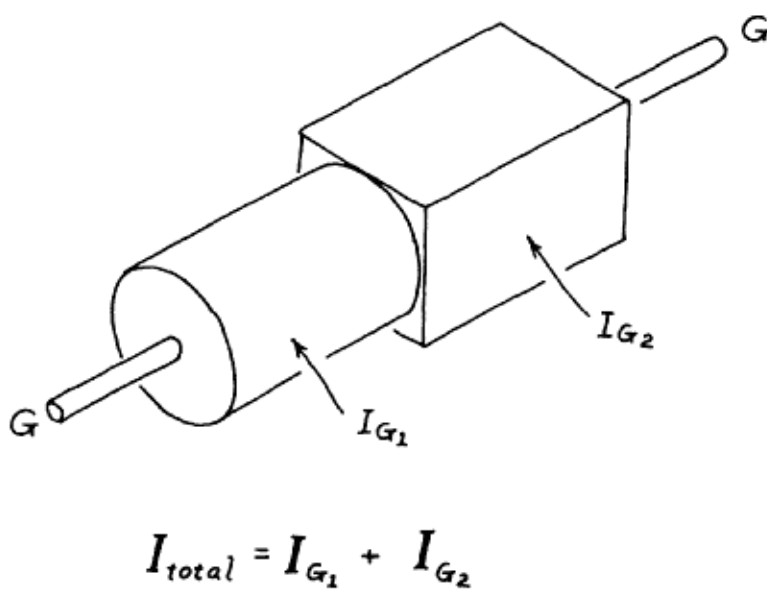


Fig. A-10. Adding inertias of simple shapes to determine the moment of inertia of a complex body. All shapes rotating about the same axis (G-G).


Moment of inertia is a function of the mass of a body and the distribution of this mass. In general, the greater the mass, the greater the moment of inertia; and the farther this mass is located from the center of rotation of the body, the greater the moment of inertia.

Figure A-9 shows several standard machine shapes and the equations for the inertias of these various bodies in terms of material density and body dimensions. More complete tables of this type are available in most engineering handbooks.

Figure A-9 shows the moments of inertia of elementary geometrical shapes only; however, most machine bodies are more complex. To obtain the inertia of a "compound" shape when all portions of the body are rotating about the same axis, the inertias of each portion are merely added together, as shown in Fig. A-10. If it is desired to know the

moment of inertia of a body about some parallel axis which does not pass through the body, the procedure and equation shown in Fig. A-11 is used. If a complex body consists of one shape on the axis of rotation and another one fastened to it that is off the axis of rotation, we use the off-axis formula to compute the inertia of the second body before adding it to the first.

Frequently, we need to relate the inertias of several bodies to a single point in the machine, even though these bodies are separated from the point of interest (perhaps the drive shaft of the motor) by

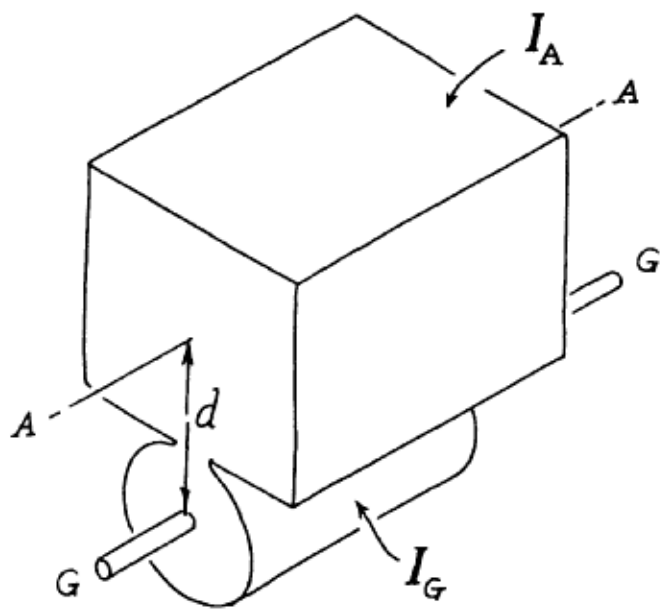

$$I_{total} = I_G + (I_A + m_A d^2)$$

Fig. A-11. Determining total moment of inertia of a complex body when portions of the body are centered on a parallel axis. Note that these "off axis" bodies are fastened to the cylinder and rotate with it, however, about axis (G-G). I_A equals the moment of inertia of the block about its own axis (A-A). M is the mass of the block.

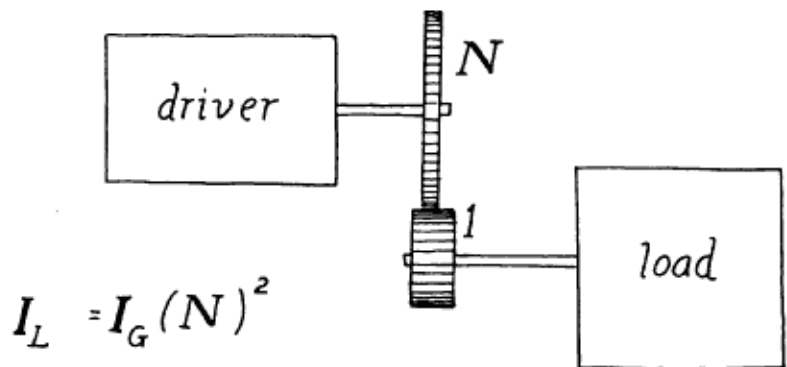
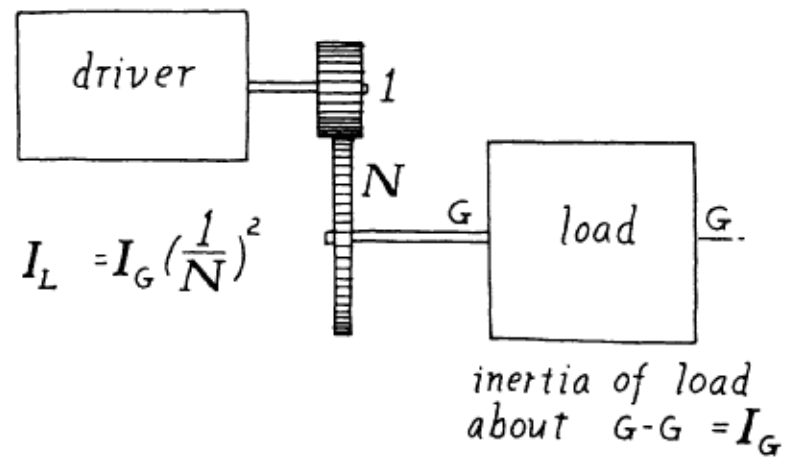


Fig. A-12. The effect of gearing on moment of inertia. In each case the calculation is for the inertia of the load as seen by the driver.

gearing, etc. In this case, the remote inertias must be multiplied by the square of the gear ratio between load and driver if the body is moving faster than the driver. If the body is moving slower than the driver, we divide by the square of the gear ratio as shown in Fig. A-12.

Bibliography

- Baasch, Thomas L. "Understanding Digital Stepping Motors." *Electronic Products*, August, 1970, p. 99 ff.
- Beling, Thomas E. "Drive System for Small or Large Angle PM Stepping Motors." *Computer Design*, March, 1971, p. 77 ff.
- Bickford, John H. "Impact." *Machine Design*, May 9, 1968.
- . "Mechanisms for Intermittent Rotary Motion." *Machine Design*, December, 23, 1965.
- . "Slip Clutches." *Machine Design*, July 21, 1966.
- . "One Turn Devices." *Machine Design*, November 21, 1968.
- . "Twelve Ways to Go One Way." *Machine Design*, August 1, 1968.
- Chiarella, L. J. "Rotation by the Digits." *Machine Design*, November 26, 1970, p. 84 ff.
- Chironis, N. "Designing for Zero Wear—or a Predictable Minimum." *Product Engineering*, August 15, 1955, p. 41 ff.
- . "Little Known Mechanisms." *Product Engineering*, December 20, 1965.
- De Carle, Donald. *Horology*. London: English Universities Press Ltd., 1965.
- Finkin, E. F. "What Happens When Parts Wear." *Machine Design*, March 19, 1970, pp. 148-154.
- Fisher, F. E. "Measurement as a Design Tool." *Machine Design*, January 22, 1959, p. 107 ff.
- Foeppl, L. "Slow Motion Pictures of Impact Tests by Means of Photoelasticity." *Journal of Applied Mechanics*, vol. 16, p. 173.
- Greenwood, D., ed. *Product Engineering Design Manual*, 1959.
- A. W. Haydon Company. "A New Range of Stepper Motors." Waterbury, Connecticut.
- Horger, O. J. *ASME Handbook of Metals Engineering Design*. 2nd ed. (Chapter 10: "Shock and Impact Considerations in Design," by I. Vigness and W. P. Welch.) New York: McGraw-Hill Inc., 1965.
- IMC Magnetics Corporation. "Tormax Steppers and Controls." *IMC Handbook*, #WMIR. Maywood, California.
- Jensen, Preben. "Cycloid Gear Mechanisms." *Product Engineering*, June 21, 1965: pp. 82-88.
- . "Machinery Mechanisms." *Product Engineering*, October 26, 1964: pp. 108-115.
- Kaplan, Joseph. "Planetary Gear." *Product Engineering*, January 4, 1960: pp. 38-41.
- Kepler, H. B. *Basic Graphical Kinematics*. New York: McGraw-Hill Inc., 1960.
- Kolsky, H. *Stress Waves in Solids*. New York: Dover Publications, 1963.
- Mathews, R. D. "The IBM Selective Composer—Multiple Index Mechanism." *IBM Journal of Research and Development*, vol. 12, no. 1, January, 1968: pp. 76-85.
- Miles, B. W., and Wilson, C. C. "The IBM Selectric Composer—Proportional Escapement Mechanism." *IBM Journal of Research and Development*, vol. 12, no. 1, January, 1968: pp. 48-59.
- Miller, C. E., "Using Stroboscopy." *Machine Design*, April 30, 1970.
- Neklutin, C. N. *Mechanisms and Cams for Automatic Machines*. New York: American Elsevier, 1969.
- "New Star Wheels Challenge Geneva Drives for Indexing." *Product Engineering*, December 18, 1967.
- Perkins, H. A. *College Physics*. 3rd ed. Englewood Cliffs, New Jersey: Prentice-Hall, Inc., 1948.

- Rappaport, S. "Kinematics of Intermittent Mechanisms: I—The External Geneva Wheel; II—The Internal Geneva Wheel; III—The Spherical Geneva Wheel." *Product Engineering Design Manual*. New York: McGraw-Hill Inc.
- Rawlings, A. L. *Science of Clocks and Watches*. 2nd ed. New York: Pitman Publishing Company, 1948.
- Rinehard, J. S., and Pearson, J. *Behavior of Metals Under Impulsive Loads*, New York: Dover Publications, Inc., 1960.
- Schmidt, E. H. "Cycloidal Crank Mechanisms." *Machine Design*, April 2, 1959.
- Shewmon, P. G., and Zackay, V. F. 1961. "Response of Metals to High Velocity Deformation." Proceedings of Technical Conference sponsored by Physical Metallurgy Commission of Institute of Metal Division; Metallurgical Society; American Institute of Mining. *Metallurgical and Petroleum Engineering*. New York: Interscience Publications.
- Shinkle, J. N. *Cylinder Escapement Performance*. Albuquerque, New Mexico: Sandia Corporation.
- Thompson, W. T. 2nd ed. *Mechanical Vibrations*, Englewood Cliffs, New Jersey: Prentice-Hall, Inc., 1959.
- Ward, F. A. B. "Time Measurement." London: Her Majesty's Stationery Office, 1966.
- . "Time Measurement, Historical Review." London: Science Museum, 1970.
- Wolf, L. J., and Diboll, W. B., Jr. "The Role of Stress Concentration in the Fatigue of Delrin." Transcript of ASME #64-WA/MD-11.
- "Wrist Watches, Pocket Watches, Stop Watches and Clocks." *Ordnance Maintenance War Department Technical Manual, TM 9-1575*, April 6, 1945, Washington, D.C., U.S. Government Printing Office.

Index

- Acceleration, angular, 25, 26
average, 19, 26
computation of, 14
definition of, 14
graphs of, 15, 21, 26, 61
gravity, 15
infinite, 22
instantaneous, 19, 26
linear, 14
measurement of, 91, 92
- Accelerometers, mass-spring, 91
strain gage, 91
- Applications of intermittent motion mechanisms, vii, 2, 97, 107-109, 115, 118, 121, 123, 126, 127, 132, 133, 137, 146-149, 151, 152, 154, 156-157, 168, 170-173, 175-178, 180, 196, 197, 205, 210, 214, 217, 221, 224, 240
- Arc suppression, 188, 189
- Body, elastic, 33-56
free, 5
- Brakes, 181-196 (see also *Clutches*)
- Camera, ciné, 137
drum, 90
high-speed motion picture, 85-87
still, 83
stroboscopic, 83
television, 85, 86
- Cams, 63, 113-126
anatomy of, 124, 125
features of, 113, 114, 124, 125, 230-232
motion characteristics of, 233, 234
performance characteristics of, 230-232
popular motion curves, 45, 63, 114-116, 120
pressure angle of, 113-114
types of, 116-126
unpopular motion curves, 115
- Center, instant, 11
of percussion, 52
- Chain and belt drives, 219-221
motion characteristics of, 239
- Circuits, electrical drive, 187-190, 212, 213
magnetic, 198-203
- Clutches, 181-196
anatomy of, 195
excitation of, 187-190
features of, 185, 186
motion characteristics of, 237, 238
motion curves, 186, 187
performance characteristics of, 230-232
systems, 181-186
types of, 181-196
vacuum, 225
- Coefficient of damping, 41, 42
Coefficient of restitution, 47, 53
Colt revolver, 126
Control, problem of, 64-67, 185, 230-232
Cost of various types of intermittent mechanisms, relative, 230-232
Coupling, eddy current, 62
Current, forcing, 188, 189
Curves, table of, 29
Cycling rates of various intermittent mechanisms, 230-232
- Dampers, 40, 41, 211, 212
coulomb, 41
step motor, 211, 212
viscous, 41
- Damping, clutch-brake, 185
constant, 41, 42
coulomb, 41, 42
critical, 41
step motor, 211, 212
viscous, 41
- Dashpot, 41
- Da Vinci, Leonardo, 31, 32, 97
- Definitions, 260
symbols used in book, 253
terms used in book, 260
- Degrees of freedom, 9
- Design, discussion of, 226-252
example, 240-252
parameters, 227
procedure, 226-229
- Detent, 143
- Differentiation, graphical, 19-21, 29-31, 254
- Differentials, table of, 32
- Displacement, angular, 26, 27
graph of, 18, 21, 23, 26, 247
linear, 18, 21
measurement of, 83-90
- Drivers, 68-71, 246-249
constant velocity, 68
hydraulic, 223, 224
input torque requirements, 69-71, 246-249
limited torque, 68, 69
pneumatic, 223, 224
rotary solenoid, 222
time dependant, 69
variable velocity, 69
- Dwell, 97
Dwell-motion ratios, 230-239
- Elastic bodies, examples, 34, 68
quasi-static model of, 34, 37
- Encoders, shaft, 87, 88
- Energy, kinetic, 29
potential, 29
- Escapement, chronometer, 161-163
clock, 152-159
feature of, 152, 153
motion characteristics of, 236
motion curves, 155, 156
performance characteristics of, 230-232
types of, 80, 154, 156, 157-159
wear of, 74
- Escapement, inverse, 34, 172-180
anatomy of, 179, 180
features of, 172-174
motion characteristics of, 237
motion curves, 174
performance characteristics of, 230-232
types of, 175-179
wear of, 78
- Escapement, Junghans, 157
- Escapement, machine, 34, 165-172
features of, 165, 166
motion characteristics of, 237
motion curves, 34, 167
performance characteristics of, 230-232
types of, 34, 99, 167-172
wear of, 72

- Escapement, runaway, 154
 features of, 154
 motion characteristics of, 236
 motion curves, 155
 torque-speed curve, 154
 wear of, 75
- Escapement, watch, 152-155, 159-164
 anatomy of, 163, 164
 features of, 152, 153, 155
 motion curves, 155, 156
 types of, 153, 154-155, 159-161
 wear of, 75
- Experimental techniques, 82-96
- Foliot verge escapement, 156
- Force, definition of, 13
 direction of, 6-8, 244, 245, 246
 graphical determination of, 14, 15, 21, 244, 245, 246
 magnification of, 60-62
 measurement of, 92-94
 more than one, 27-29
 reduction of, 60-65
 units for, 254
 vector representation of, 3-5, 100, 101
- Forced vibration, 38-42
- Forcing, electrical, 188-190
- Freedom, degrees of, 9
- Frequency of vibration, damped, 43
 resonant, 40
 undamped, 40
- Galileo, 96
- Gatling gun, 121
- Gears, 139-151
 anatomy of, 149-151
 cycloidal, 139, 144
 differential, 142, 143, 146, 147
 epicycloidal, 139, 144, 145
 features of, 139, 230-232, 235, 236
 hypocycloidal, 139-141
 motion characteristics of, 235, 236
 motion curves, 140-142
 mutilated, 140-144, 216
 performance characteristics of, 230-232
 planetary, 139-143, 145
 types of, 99, 139-150
- Geneva, 61, 127-138, 215, 216
 anatomy of, 136, 137
 drive torque requirements, 69-71
 external, 127, 129-131
 features of, 127, 136-137, 230-232, 234, 235
 forces on, 69-71
 instrument, 132, 134
 internal, 127, 129, 131, 132
 machine, 2, 133
 motion characteristics of, 234, 235
 motion curves for, 24, 78, 128, 129
 performance characteristics of, 230-232
 spherical, 127
 torque on, 69-71
 types of, 99, 127-128, 131-137, 146
 velocity of, 12
 wear of, 61, 75, 78, 79
- Gerber, Roger, 123
- Glossary of terms, iv
- Golfer, paradox of, 56
- Graham, George, 158
- Graphs, 2
 acceleration (angular), 26
 acceleration (linear), 21
 displacement (angular), 26
 displacement (linear), 21
 FAVD, 21
 force, 21
 tables of, 29
 torque, 26
 velocity (angular), 26
 velocity (linear), 21
- Gratings, optical, 88
- Gravity, acceleration of, 15
- Grimthorpe, Lord, 158, 159
- Hooke, Robert, 158
- Impact, basic concepts, 33-37, 46-56, 65-67
 center of percussion, 51
 change in energy during, 47-49
 change in momentum during, 47
 combined linear and rotary, 50-52
 conservation of momentum, 46, 52
 control during, 65-67
 energy loss during, 47
 forces during, 35-37, 59, 60
 linear, 46-50, 54-56
 maximizing impact effects, 54-56
 minimizing impact effects, 54-56, 251
 multiple body, 53, 54
 noise, 97
 rotational, 50-54
 torque during, 35, 36
 translational, 46-50, 54-56
 translational plus rotational, 50-52
 velocity before, 47
 velocity following, 47
 wear of, 75-77
- Impulse, 49-52
- Indexing mechanisms, cams, 113-126
 chains and belts 219-221
 clutch-brakes, 181-196
 gears, 139-151
 Genevas, 127-138
 linkage drives, 220, 221
 machine, escapements, 165-172
 ratchets, 97-112
 star wheels, 215-217
 stepping motors, 197-214
- Inertia, 257-259
 calculating, 259
 moment of, 26, 257
 table of moments of, 258
- Input, angles, 233-239
 torque requirements, 68-71
 types of, 68, 69
- Input-output motions for various mechanisms (see *Motion Characteristics*)
- Instant centers, 11
- Integrals, table of, 32
- Integration, graphical, 15-19, 21, 29-31, 254
- Intermittent motion mechanisms, cams, 113-126
 chain and belt drives, 219-221
- Intermittent motion mechanisms, clock and watch escapements, 152-164
 clutch-brake drives, 181-196
 gears, 139-151
 Genevas, 127-138
 inverse escapements, 172-180
 linkage drives, 220, 221
 machine escapements, 165-172
 miscellaneous types, 221-224
 PRIM, 224, 225
 ratchets, 97-112
 relative cost, 230, 232
 roll cams, 217-219
 star wheels, 215-217
 step motors, 197-214
- Ives, Joseph, 164
- Jerk, 24, 25, 115, 127
 definition, 24, 25
 graph of, 25
- Junghans escapement, 157
- Linkage drives, 220, 221
 motion characteristics of, 239
- Load capacity (relative) of various mechanisms, 230-232
- Magnetic circuits, 198-203
- Magnetic measurements, 89
- Maier, Karl, 90
- Measurement of, acceleration, 91, 92
 displacement, 83-90
 force, 92-94
 noise, 94
 torque, 92-94
 velocity, 90, 91
- Measurements, 82-96
 continuous, 83
 digitized, 83
- Mechanical advantage, 166, 230-232
- Mechanics, elastic body, 33-56
 graphical, 13-32
 of intermittent motion, 57-71
- Milestone measurements, 83
- Mirror use in differentiation, 256
- Miscellaneous types of intermittent mechanisms, 221-224
- Models, analogue, 95
 dimensional, 94, 95
 elastic body, 34-35
 experimental, 1, 95
 importance of, 1, 82
 mathematical, 1, 95
 mechanical, 95
 quasi-static, 34-36, 37
- Moiré fringe techniques, 88
- Momentum, 29, 46, 47, 49, 50
 angular, 50-52
 conservation of, 46, 52
 definitions, 46
 linear, 29, 46, 47
- Motion characteristics of various intermittent mechanisms, 230-239
- Motion curves, acceleration (angular), 26, 27
 acceleration (linear), 14, 15, 21
 brakes, 186, 187
 cam-input ratchet, 62, 63, 102

- Motion curves, cams, 45, 63, 114-116
 clock escapement, 155, 156
 clutches, 186, 187
 cycloidal gear, 141
 derivation of, 14-24, 29-32, 246-249
 differential gear, 142
 displacement (angular), 27
 displacement (linear), 18, 19, 21
 escapement, 155, 156, 167, 174
 FAVD, 21
 gear, 140-142
 Geneva, 129
 Geneva-gear combinations, 136
 impulse ratchet, 58, 102
 inverse escapement, 174
 jerk, 25
 machine escapement, 167
 mutilated gear, 140
 popular curves of cams, 45, 63, 114-116
 ratchet, 58, 62, 63, 102
 runaway escapement, 155
 star wheel, 217, 246-249
 step motor, 210-211
 unpopular curves of cams, 115
 velocity (angular), 26
 velocity (linear), 15-17, 21
 watch escapement, 155, 156
 Mudge, Thomas, 160, 161
 Mutilated gearing (see *Gears*)

 Neklutin, C. N., 116
 Noise, measurement of, 94
 use in analysis, 94

 Optical, measurements, 83-87
 tracking, 89, 90
 Optron, 89, 90
 Output angles of various intermittent mechanisms, 233-239
 Output torque, 71, 248-249
 Overvoltage, 189, 190

 Pawl, drive, 100, 101, 111, 112
 no-back, 102, 111, 112
 non-overthrow, 102, 111, 112
 ratchet, 100, 101
 Percussion, center of, 52
 Performance of intermittent mechanisms compared, 230-239
 Photoelasticity, 92, 93
 Piezoelectric crystals, 91
 Planimeter, 254
 Pneumatic actuator, 223
 Pneumatic clutch, 195
 PRIM, 224, 225
 motion characteristics of, 239
 Printer, design of, 240-252
 Prism use in differentiation, 256
 Problem, of control, 64-67
 of force magnification, 60-64
 of speed, 67, 68

 Quasi-static model of elastic bodies, 34-36, 37

 Ratchet, 97-112
 anatomy of, 111, 112

 Ratchet, cam input, 62
 clutch, 182
 features of, 97, 100, 111, 112, 230-233
 forces on, 100, 101
 horseless carriage, 98
 impulse input, 57-60
 motion characteristics of, 233
 motion curves for, 60, 101, 102
 performance characteristics of, 230-232
 spring driven, 57-60
 types of, 98, 100, 102-111
 wear of, 75, 78, 79
 Reliability, 72-81
 Remington typewriter, 151
 Riefler's escapement, 159
 Robey-Smith bevel gear planer, 214
 Roll cams, 217-219
 motion characteristics of, 239
 performance characteristics of, 231, 232

 Shaft encoders, 87-88
 Simpson, Theodore, 224, 225
 Slope, calculation of, 19, 254, 256
 definition of, 19
 use of, 19
 Solenoid, rotary, 222, 239
 Spring rate, elastic body, 37
 Stability, 72, 230-232
 Star wheel, 215-217
 external, 215-217, 246, 249
 internal, 217
 motion characteristics of, 238, 239
 performance characteristics of, 230-232
 Stepping motor, anatomy of, 213-214
 applications of, 240
 damping, 211, 212
 electrical circuits for, 212, 213
 electro-hydraulic, 206-208
 features of, 197, 198, 230-232, 238
 flexible spline, 207-209
 motion characteristics of, 238
 motion curves for, 210, 211
 performance characteristics of, 230-232
 permanent magnet, 203-205
 planar, 209-210
 ratchet, 108, 210
 types of, 203-210
 variable reluctance, 205, 206
 Strain gages, 92
 Stroboscopic measurements, 83-85

 Tables, applications of intermittent motion mechanisms, 240
 curves, 29
 design parameters, 237
 differentials, 29
 inputs-outputs for mechanisms, 71, 233-239
 integrals, 29
 moments of inertia, 257
 motion characteristics, 233-239
 motion curves, 29
 performance characteristics, 230-232

 Tables, symbols, 253
 units, 254
 Tangent, 19, 257
 Tavano escapement, 160, 161
 Television, closed circuit, 85, 86
 Time constant, 188-190
 Torque, computing, 35-37, 59, 69-71, 246-249
 drive, 68-71, 246-249
 graph of, 26, 36, 58
 measurement of, 92-94
 Torsion bars, 93, 94
 Tschudi, Traugott, 118
 TV (see *Television*)

 Units, algebraic treatment of, 16-18
 table of, 254
 used in this book, 12, 254
 Uses of intermittent motion mechanisms (see *Applications*)

 Vander, Curtis, 180
 Vectors, 3-5
 addition of, 3, 4
 definition of, 3
 force, 3
 subtraction of, 4
 velocity, 3
 Velocity, 3, 10
 angular, 10
 computation of, 11, 12, 247
 graphs, of, 15-17, 21, 26, 247
 impact, 47
 instantaneous, 3
 linear, 10
 measurement of, 90, 91
 vector representation of, 3
 Verge, Foliot, 156
 inverse escapement, 172, 174
 runaway escapement, 153, 154, 156, 157
 Vibration, 37-46
 basic concepts, 37-46
 coulomb damped, 41
 coupled oscillators, 44-46
 during impact, 48
 forced damped, 40-42
 forced undamped, 38, 39, 42
 free, 42-46
 frequency of damped, 43
 frequency of undamped, 40
 friction damped, 41
 resonance, 40
 shock excitation, 42-44
 step excitation, 44
 summary chart, 42
 undamped, 38-40, 42
 viscous damped, 41

 Wear, 72-81
 effects on intermittent mechanisms, 74-80
 rates, 73-74
 types of, 72-73
 Willcox and Gibbs sewing machine, 196
 Work, 29

 Zugel, Martin J., 216

TJ181
B5
(ST)

